

TIP SHEET



PUBLISHED BY BULLSEYE GLASS CO. 3722 SE 21ST AVENUE, PORTLAND, OR 97202 ©2003

BULLSEYE BOX CASTING REVERSE RELIEF KILNCASTING IN AN ASSEMBLED MOLD

This TipSheet will introduce you to ways to create a reverse relief cast glass object with the optical clarity of a furnace casting using plaster silica design elements in an open face mold assembled from vermiculite board and other refractory materials. In this process there will be less waste than with traditional kilncasting processes and the majority of the mold will be reusable. The molds themselves will be of uniform thickness, allowing for even heating and cooling. Furthermore, the molds will not fail at casting temperature, which is among the most common concerns in kilncasting, and one of the reasons that there is such a boggling array of mold recipes in use. The results are typically much cleaner and more predictable than kilncasting in most of the traditional methods, and the process is extremely easy to repeat for the purposes of making editions or production work.



Rafael Cauduro, *Tzompantli D*, 2002, 100 x 57 x 5 cm

to begin researching other ways of building these molds. After the conclusion of the project, this research continued. TipSheet 5 will lead you through the processes that were subsequently developed.

WHERE YOU ARE GOING: THE FINISHED PIECE

The end result will be a solid block of glass with relief imagery in the back of the piece that when viewed through the flat front of the piece creates a nearly holographic image. Its top surface will be glossy and smooth. If carefully planned and executed, the top perimeter will have a soft, bullnosed edge. Occasionally, some cold work may be necessary,

or may be a tremendous advantage in the finished work. The finished block will measure about 19.5 x 19.5 x 4 cm. These dimensions may be enlarged by adapting the general guidelines and adjusting the firing schedule.



ORIGINS OF THE METHOD

This method of kilncasting developed as an outgrowth of an artist exchange project in our Research and Education department with Mexican artist Rafael Cauduro. Cauduro had originally come to the factory to work in methods known as Painting With Light, but quickly became intrigued with kilncasting processes and began to make large scale cast glass sculptures using traditional "monolithic" or one-piece refractory molds. The fabrication, handling, and technical challenges posed by making and firing these molds ultimately led the R&E team, assisted by Ray Ahlgren,*

MATERIALS

Glass: Because clarity is essential to creating a reverse-relief casting, we recommend using any of *Bullseye's 1800 series* casting tints in billet form. Because they have smoother surfaces and less surface area by weight than other forms of glass, billets will trap less air than

* Ray Ahlgren, owner of Fire Art, Inc. in Portland, Oregon, was one of Bullseye's three founders and instrumental in the company's early explorations into kilnformed glass. Fire Art specializes in larger scale fusing and multiple production methods with an emphasis on architectural and limited edition lighting.

frit, powders, or sheet glass, and therefore create fewer bubbles in the final piece. Billets are preferable not only for the clarity they produce in the finished casting, but also because they are easy to handle, cut, and load into the mold. The 1800 series glasses are formulated to gradually transition in color saturation as they go from thick to thin, making them ideal for this, and other casting processes.

Other materials:

- *clay and tools* for modeling design elements
- *metric scale*
- *metric ruler*
- *moldmaking material* such as Hydrogel N mold compound (alginate)
- *mixing containers*
- *bucket of water* for initial clean-up
- *bucket of water* for rinse
- *Skamol 600 density 2.5 cm vermiculite board*
- *stainless steel (deck) screws*
- *plaster/silica* or similar refractory investment material
- *fiber paper*
- *Vaseline/petroleum jelly*
- *Murphy's Oil Soap*
- *946 ml Ziploc food storage box*, or equivalent
- *garbage can with liner*
- *self-lubricating glass cutter*
- *hammer*

NOTES ON METRIC MEASUREMENTS

For the sake of simplicity all units of measure in this TipSheet are Metric. The decimal format of the metric system and its direct and simple translation from length to volume to weight in water makes it a superior system for laboratory work.

In the metric system:

1 cubic centimeter (cm³) of water = 1 milliliter (ml) of water = 1 gram (g) of water

If the interior of an empty box measures 20 x 20 x 2.5 cm, then this interior has a volume of 1000 cm³. 1000 cm³ of water is equal to 1000 ml of water, which is equal to 1000 g of water.

MAKING A MOTHER MOLD

Preparing a model using clay or a found object:




Prepare a model no larger than 5 x 5 x 3 cm using either water- or oil-based clay. This model will be used to make the design elements that will create the reverse relief imagery in the final casting. Water-based clay is usually softer and can be modeled very quickly, and

can be reused and recycled. However, it will dry out over time, and will shrink as it does so. Oil-based clay is usually firmer, does not dry out, holds fine detail very well, is reusable, and releases very easily from most mold materials such as alginate, rubber, and silicone.

Found objects may need to be coated with a release, such as Vaseline or Murphy's Oil Soap.

For this particular process using an alginate mother mold, the model itself should have minimal undercuts.

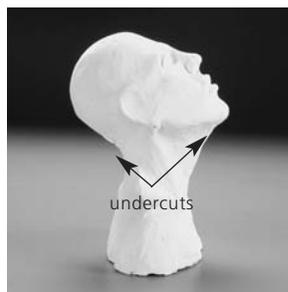

Undercuts on found objects can be filled in with clay. The very bottom portion of these design elements will end up being submerged in investment material to hold them in place in the final casting process, so plan accordingly.

Preparing to pour a mother mold:



Place the model into a box with a minimum of 15 mm of space all around it; a 10.5 x 10.5 x 9 cm flexible plastic food storage box (Ziploc) with a slight draft to the sides works well.

The box serves as a coddle system, or a set of dams,

into which you will pour the alginate to make the mother mold. Use something like petroleum jelly to secure the model to the bottom of the box to keep it from moving or floating once you have poured in the mother mold material.


Types of flexible mother mold material for casting multiple copies:

Hydrogel N mold compound is a type of alginate that is fairly easy to mix and sets in 5-10 minutes. It is somewhat weak with a short working life and will dry out and shrink over a couple of days, but if kept in a sealed container and treated carefully, it will usually last a few weeks.

RTV Rubber (Room Temperature Vulcanizing) is activated at room temperature but can have long set times and often takes 24 hours to cure into a very durable, very strong material.

Mixing Hydrogel N mold compound:

Measure box/coddle system—including 1.5 cm above the model in the calculation. For our specific box and model this is 10.5 x 10.5 x 4.5 cm which equals 496 cubic cm, which means that it will take 496 grams of water to fill the box to the appropriate level. The manufacturer of Hydrogel N mold compound recommends mixing it 3 parts water to 1 part Hydrogel N by weight and adding the mold compound to the water, but we have had good success mixing it 4 parts water to 1 part Hydrogel N by weight and adding the water to the Hydrogel. For our project, then, we will need 496 grams of water and 124 grams of Hydrogel. We have had the best success mixing this with a spatula in a bowl using a folding, not a beating motion, to avoid creating bubbles in the mix. Work in a well-ventilated area and wear a NIOSH approved respirator whenever working with powdered materials or dusts.

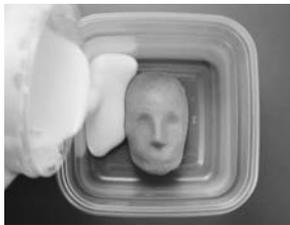

Pouring the Hydrogel:

Be certain that you are working on a flat and level surface. Pour to one side of the object in a flowing motion to keep air from getting trapped on the surface of the model. Vibrate the worktable so that the air bubbles don't get stuck to the model.



Cleanup:

Using water immediately makes a mess. Allow remaining Hydrogel to dry in the container and then immerse in bucket of water for initial clean up. Once cured, it is possible to peel the Hydrogel out as a skin. Never pour into a sink.

Removing the mother mold from the coddle box:



Turn the coddle box upside down on the work table and squeeze and push the flexible walls to let air into the sides until the mold drops out. Turn the mold over again and squeeze it and push carefully to force the clay model out. You now have a flexible mother mold for pouring multiple copies of your model in another material.

MAKING DESIGN ELEMENTS OUT OF INVESTMENT MATERIAL

Many different investment materials and recipes exist. In our factory Research and Education department we use a simple mixture of 50% #1 casting plaster and 50% silica flour (325 mesh) mixed by weight.

Measuring investment material:

Measure original model and overestimate its size; it is better to discard some inexpensive investment than to run out and have to quickly mix more material. Our model is roughly 5 x 5 x 5 cm = 125 cubic cm. Referring to the Investment Ratio chart on page 8, we can add together the amounts of material needed for voids of 100, 20, and 5 cubic centimeters to get the proper quantities of water and investment required for our 125 cubic centimeter void. This means that we will need 79.99 grams of water and 139.98 grams of investment. Weigh these materials in clean, dry buckets. Remember to work in a well-ventilated area and wear a NIOSH approved respirator whenever working with powdered materials.

Mixing investment material:

Steadily sift all of the required investment into the water. An island of dry material will begin to form once you have sifted most of the material into the water. Allow the investment to fully hydrate/become saturated. If left alone, the investment can sit for quite some time. Once the mixture is saturated, dip your hand in and break up any chunks. Feel the consistency (you want a creamy texture). The plaster in the mix will begin to work/set up after it has been agitated or mixed, whether by hand or drill.


Pouring the mixed investment into the mother mold:

Be certain that you are working on a flat and level surface. If you have a lot of fine detail, begin by brushing some investment mix into the details in the mother mold—this breaks

the surface tension so the mix can go into the details. Aim for one place in the mother mold and pour in a flowing motion to avoid creating bubbles. Once you have finished pouring, vibrate the work surface to make certain that no air is trapped within the details of the mother mold.

Clean up:

Clean investment mixing buckets right away—old plaster in mixing buckets, on hands and/or on tools will cause subsequent batches of investment to set before you have a chance to pour them. It is good to use black or colored buckets so that you can easily spot old plaster in the buckets. Never pour investment into a normal sink as this will clog your pipes. Pour excess investment into a garbage can that has a liner in it. From there, have two buckets of water to use in your cleaning operation: one bucket for cleaning and scrubbing the mixing buckets, and one bucket for rinsing them. When these buckets become too filled with waste investment to continue using them, allow them to settle, then pour off the excess water and dispose of the waste investment in garbage bags.

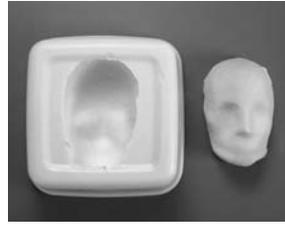After investment has set up:

It usually takes 5-20 minutes for the investment to set.

Lightly touch the surface of the investment to test its hardness. Once it has set, the plaster/silica design element can be removed in

the same fashion that the clay model was. Immediately after setting, the design element will still be a little soft, which means that it can be easily modified with simple clay tools at this point. After the design element hardens, it will still be possible to modify it, but it may be necessary to use power tools for the sake of speed.

Store the alginate/Hydrogel mother mold in a closed container for later use, being careful to keep it from drying out.

● BUILDING THE BOX MOLD WITH VERMICULITE BOARD

Vermiculite Board:

Vermiculite has a bad reputation because it is often mined in the same places as asbestos, which can contaminate the vermiculite. This particular vermiculite board from Skamol comes from a mine that is certified asbestos free. It is stronger, more durable, and less expensive than most fiberboard, and can be cut and tooled just like wood or particle board. Work in a well-ventilated area and wear a NIOSH approved respirator whenever generating dusts.

If you want your finished piece to be level and square, it is important to cut the vermiculite boards very accurately. Also, pre-drill and counter-sink screw holes so the board does not bloat or blow out when you screw it together. Use stainless steel screws to put the mold together as they will hold up to repeated firings without flaking. *Do not use galvanized steel screws because upon firing the galvanization will release toxic fumes and the screws will flake and cause contamination in your kiln.*

Cut two long side boards at 25.5 x 9 x 2.5 cm, two short side boards at 20 x 9 x 2.5 cm, and one base board at 25.5 x 25.5 x 2.5 cm. Lay the boards out as an open box and pre-drill holes in the flat surface of the long side boards to connect them to the ends of the short side boards using a bit that has a diameter slightly smaller than the diameter of the stainless steel screws. Be sure to drill your holes on center to avoid blowing out the side of the board. Then screw the

sidewalls together. Next, set the base board on top of the assembled side boards and pre-drill holes to join it to the sides, and then screw it together. Then take the entire box apart and fire the vermiculite board to a temperature of 860°C, (1580°F) or about 17°C (30°F) higher than the temperature at which you will cast the glass, hold it at that temperature for half an hour, and then crash cool the kiln.



Once the boards are cool, take them out and reassemble the sides using the stainless steel screws. Cut a piece of 3mm fiber paper at 25.5 x 25.5 cm and set it on the base board,

then set the assembled sides on top of the fiber paper, and screw the box together. Line the side walls with 3mm fiber paper, making sure that it fits tightly, without bowing or leaving gaps in the corners.


AFFIXING DESIGN ELEMENTS WITHIN THE BOX

The design elements must be held firmly in place for the glass casting process. To hold them, a shallow layer of investment is poured into the bottom of the box around the design elements.



Hydrate the plaster/silica design elements by soaking them in water until the bubbles quit rising (5-10 minutes). This helps keep the plaster/silica bed from sucking in around the design

elements due to differences in humidity. Arrange design elements on the interior base of the box. Check once again to make certain that your work surface is flat and level.

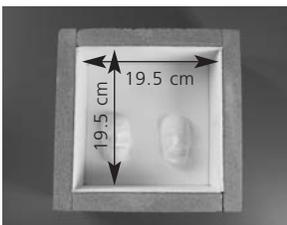

Measure the inside of the box to determine the appropriate amount of investment material needed. Our box is 19.5 x 19.5 cm and we need enough investment to fill it about 0.5 cm deep. Thus,

the investment needs to fill a void that is 190 cubic centimeters. Referring to our investment (plaster/silica) mixing table we see that there is a batch listed for 200 cubic cm, which will be more than enough.

Mix the investment according to the previous directions and pour it quickly and evenly. Avoid pouring the mix directly onto the design elements or the side walls. Vibrate the work surface to make the investment level out.

Set aside the box mold for 24 hours to make sure that all of the plaster/silica components of the mold have cured to an adequate hardness. As with the design elements, you may choose to modify the "affixing" layer of investment.

SELECTING GLASS

You may select any form of Bullseye glass to fill the mold (billet, cullet, sheet, frit, etc), but the form that you select will have a direct impact on the clarity of the casting. The smaller the form of the glass, the more air bubbles in the finished piece, the less optical clarity. Powders and fine frits will create so many air bubbles that even our Crystal Clear 1401 will appear milky white and opalescent when used at this 4 cm thickness.

Because this is a reverse relief casting and the intention is to see the imagery created by the design elements through the surface of the finished piece, using billets will give you the desired clarity.

Calculating glass to fill the mold:

Measure the inside of the box mold. Then figure out the cubic volume. Use a specific gravity of 2.5 for Bullseye glass to calculate how much glass will be needed to fill the mold to the desired thickness (BE glass is approx. 2.5 times heavier than water).

Our box mold:

$$19.5 \times 19.5 \times 4 \text{ cm (desired thickness of casting)} = 1521 \text{ cm}^3.$$

$$1521 \times 2.5 = 3802.5 \text{ (grams of glass needed)}$$

This does not account for the displacement of glass caused by the design elements.

If you would like to account for the displacement caused by the design elements or if you have an irregularly shaped mold, you can use rice for a more precise measurement. Fill your mold with rice to the desired thickness of the casting. Then remove the rice and decant it into a square or rectangular container for which it is easy to calculate cubic centimeters. It will take 2.5 grams of Bullseye for every cubic centimeter of rice.

Use a reliable scale to weigh out the amount of glass you will need.

Cutting the billet:

Use a self-lubricating glass cutter to score glass using about the same amount of pressure required to score 3mm sheet glass.




It is always easiest to break the score if it is made along the centerline of the piece of glass. In other words, cut the billet in half, then in half again, to get the appropriate sizes to fill the mold.



Find the score line and break with big running pliers or hold the billet in a gloved hand and use a hammer to open the score by tapping on the back of the glass underneath the score line—

this does not take a lot of force—a tap exactly under the score line will cause the score to open cleanly. Hold the billet low and over the table so it does not fall on your foot. Remember to wear eye protection.

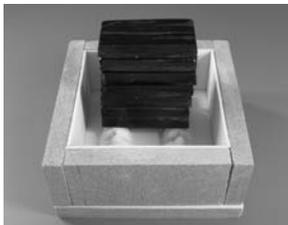Loading the glass into the mold:


Clean and dry the glass thoroughly, making sure to remove any stickers. Any glass that is going to be lower than the thickness of final piece can be against the mold wall, but be careful

not to indent the fiber paper, because it will create a bump on the finished glass piece. Stack the rest of the glass into the center of the mold.

Loading the mold into the kiln:

Make sure the kiln is level and make sure the mold is level. Set the box molds on kiln furniture/posts, establishing three points of contact, at least 2.5 cm from the floor of the kiln.

This will allow heat to circulate all around the mold.

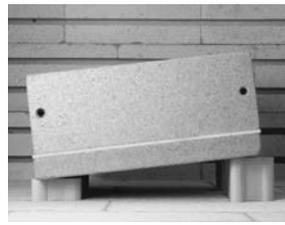

If you would like to intentionally create a wedge shape, you may set up the mold on an angle, but make certain that you have enough glass to cover the design elements, and that

you adjust your annealing schedule to accommodate for the thicker area in the casting. If, for example, you would like a wedge that is 5 cm on the bottom and 2.5 cm on top, you will want to support the end that will be thicker on 2.5 cm kiln furniture, and the end that will be thinner on 5 cm kiln furniture, and then calculate the glass as if you were casting a rectilinear volume with a thickness of 3.75 cm.

FIRING THE PIECE**F A H R E N H E I T**

RATE (°F/HR)	SET POINT TEMPERATURE (°F)	HOLD TIME (HR:MIN)
100	200	6:00 ^A
100	1250	2:00
600	1550	1:00
AFAP	960	3:30
12	740	:00
24	655	:00
120	75	:00

C E L S I U S

RATE (°C/HR)	SET POINT TEMPERATURE (°C)	HOLD TIME (HR:MIN)
55	93	6:00 ^A
55	677	2:00
332	843	1:00
AFAP	516	3:30
6	393	:00
13	346	:00
66	24	:00

^A This time can vary. Set the time to ensure you will be in the studio to close the vents and then be present when the casting reaches process temperature to allow for a visual inspection.

Vent the kiln at least up to 593°C/1100°F to make certain that all of the moisture has escaped the kiln. Plan to be present when the kiln is at casting temperature and visually inspect the piece to make sure the casting is going as planned. If unwanted bubbles are present on the surface or just below the surface of the piece, plan to extend the hold at casting temperature until the bubbles have burst and healed.

Firing schedules provided are specific to the Paragon GL24AD kilns that we use in our factory Research and Education department. All kilns fire differently. You may need to adjust the firing schedule for your specific kiln and project.

After the entire firing cycle is complete, we recommend leaving the piece in the kiln at room temperature for at least a day before taking it out to divest it.

CLEANING THE FINISHED PIECE



Remove the piece from the kiln and disassemble the box mold. Remember to wear an approved mask while handling the fired fiber paper and investment materials. Watch out for any

sharp points if the glass has clung to the side walls of the mold.

After taking the piece out of the mold, you can remove the investment material with a variety of tools (dental instruments, wooden picks, wire and brass brushes, wood carving tools). Be gentle in areas where the glass is very thin by using wooden tools or working very carefully with metal tools. Always remove all of the investment material before scrubbing with water. Now that the investment material has been fired, the plaster is active again. As soon as you get the investment material wet it is going to set again and it will make it much more difficult, if not impossible to remove. Furthermore, when the plaster/silica starts to set, it generates heat and expands. This may be a problem if you have plaster stuck in small cracks: it can cause the glass to thermal shock or force it to open as if scored.



Remember that you can create a very different effect if you decide to coldwork and/or polish your piece. The optical qualities can change substantially – especially with coldworking on the edges.



Ted Sawyer, *Speak*, 2003, 19.5 x 19.5 x 4 cm

INVESTMENT RATIO – IMPERIAL

SIZE OF VOID	INVESTMENT MIX WEIGHTS	
	CUBIC INCHES	INVESTMENT WEIGHT
1	0.02 lbs	0.04 lbs
2	0.05 lbs	0.08 lbs
3	0.07 lbs	0.12 lbs
4	0.09 lbs	0.16 lbs
5	0.12 lbs	0.20 lbs
6	0.14 lbs	0.24 lbs
7	0.16 lbs	0.28 lbs
8	0.19 lbs	0.32 lbs
9	0.21 lbs	0.36 lbs
10	0.23 lbs	0.40 lbs
20	0.46 lbs	0.81 lbs
30	0.69 lbs	1.21 lbs
40	0.93 lbs	1.62 lbs
50	1.16 lbs	2.02 lbs
60	1.39 lbs	2.43 lbs
70	1.62 lbs	2.83 lbs
80	1.85 lbs	3.24 lbs
90	2.08 lbs	3.64 lbs
100	2.31 lbs	4.05 lbs
200	4.63 lbs	8.10 lbs
300	6.94 lbs	12.14 lbs
400	9.25 lbs	16.19 lbs
500	11.57 lbs	20.24 lbs
600	13.88 lbs	24.29 lbs
700	16.19 lbs	28.33 lbs
800	18.50 lbs	32.38 lbs
900	20.82 lbs	36.43 lbs
1000	23.13 lbs	40.48 lbs
2000	46.26 lbs	80.96 lbs
3000	69.39 lbs	121.43 lbs
4000	92.52 lbs	161.91 lbs
5000	115.65 lbs	202.39 lbs
6000	138.78 lbs	242.87 lbs
7000	161.91 lbs	283.34 lbs
8000	185.04 lbs	323.82 lbs
9000	208.17 lbs	364.30 lbs
10000	231.30 lbs	404.78 lbs


Imperial: Water weights on this chart are derived by multiplying the size of the void by 0.02313.

DIRECTIONS:

- A. Decide your shape (square, rectangle)
- B. Set up your coddles. Leave space (about 5 cm) around and above project.
- C. Use formulas to find the volume of your void (inside of coddles).

(a) SQUARE & RECTANGLE

Formula = $(l \times h \times w)$

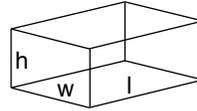


Example:
length = 25.4 cm
height = 12.7 cm
width = 17.8 cm

Volume: $25.4 \times 12.7 \times 17.8 = 5,741.9 \text{ cm}^3$

(b) CYLINDER

Formula = $\pi r^2 \times h$

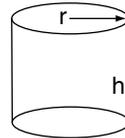

Example:
radius = 10 cm
height = 17.8 cm
 $\pi \approx 3.14$

Volume: $3.14 \times 100 \times 17.8 = 5,589.2 \text{ cm}^3$ (could add together 5000 and 600 from chart)

TIPS:

Do not pour plaster down a drain.

Always wear a respirator approved by NIOSH for silica dust when handling dry materials (NIOSH=National Institute of Safety and Health)

INVESTMENT RATIO – METRIC

SIZE OF VOID	INVESTMENT MIX WEIGHTS	
	CUBIC CENTIMETERS	INVESTMENT WEIGHT
1	0.64 g	1.12 g
2	1.28 g	2.24 g
3	1.92 g	3.36 g
4	2.56 g	4.48 g
5	3.20 g	5.60 g
6	3.84 g	6.72 g
7	4.48 g	7.84 g
8	5.12 g	8.96 g
9	5.76 g	10.08 g
10	6.40 g	11.20 g
20	12.80 g	22.40 g
30	19.20 g	33.59 g
40	25.59 g	44.79 g
50	31.99 g	55.99 g
60	38.39 g	67.19 g
70	44.79 g	78.38 g
80	51.19 g	89.58 g
90	57.59 g	100.78 g
100	63.99 g	111.98 g
200	127.97 g	223.95 g
300	191.96 g	335.93 g
400	255.95 g	447.91 g
500	319.94 g	559.89 g
600	383.92 g	671.86 g
700	447.91 g	783.84 g
800	511.90 g	895.82 g
900	575.88 g	1007.80 g
1000	639.87 g	1119.77 g
2000	1279.74 g	2239.55 g
3000	1919.61 g	3359.32 g
4000	2559.48 g	4479.09 g
5000	3199.35 g	5598.86 g
6000	3839.22 g	6718.64 g
7000	4479.09 g	7838.41 g
8000	5118.96 g	8958.18 g
9000	5758.83 g	10077.95 g
10000	6398.70 g	11197.73 g

Metric: Water weights on this chart are derived by multiplying the size of the void by 0.63987.

NOTES:

Charts are not equivalent (10,000 cm³ is significantly less volume than 10,000 in³).

Add together any combination of chart listings to best fit your project size.

The investment recipe we have used is: 50% 325 mesh silica flour + 50% #1 casting plaster by weight.

This chart uses a 1:1.75 ratio (water:investment).

The investment ratio is suitable for many casting projects.

If you would like additional TipSheets for use in classes or distribution to your organization, they are available from Bullseye for 20¢ per copy plus shipping.

BULLSEYE GLASS CO.
3722 SE 21st Avenue, Portland OR 97202
T/503.232.8887 F/503.238.9963
www.bullseyeglass.com

THE BULLSEYE CONNECTION:
A GLASSWORKING RESOURCE CENTER
3610 SE 21st Avenue, Portland OR 97202
T/888.220.3002 (toll-free) F/503.227.3130
www.bullseyeconnection.com